

[Next Unread Message](#)[View Message](#)

<b>Sent on</b>	08	03	2016	<b>Expires on</b>	10	31	2016
----------------	----	----	------	-------------------	----	----	------

<b>From</b>	Campaign Administration
-------------	-------------------------

<b>Subject</b>	Product Update: 2015-16 Accord and 2015-16 CR-V DTC P1890
----------------	---

DATE: August 3, 2016

TO: All Honda Sales, Service &amp; Parts Managers and Personnel

FROM: Campaign Administration

Re: Product Update: 2015-16 Accord and 2015-16 CR-V DTC P1890

Today, August 3, 2016, American Honda Motor, Co., Inc. is announcing a product update for model year 2015-16 Honda Accord and CR-V vehicles to address incorrect CVT operation and DTC P1890.

**Basic Problem**

An incorrect learning value in the PCM may cause a pressure problem in the CVT under certain driving conditions causing a surge in RPM because the CVT belt slips at highway speeds, and will eventually set DTC P1890 (CVT speed control system).

**The Repair**

Perform an inspection of the vehicle's PGM-FI and check for DTC P1890. If the code is not set, please update the PGM-FI software. If the DTC P1890 is set, replace the transmission and update the PGM-FI software.

There are some 2015 CR-V vehicles that previously received PGM-FI software for vibration at idle. These vehicles will not directly accept the software in this bulletin and will require service bulletin 16-057, *2015 CR-V DTC P1890* to update the PGM-FI system. Follow the information in service bulletin 16-053 for further guidance.

**Service Bulletin**

Service bulletin 16-053, *Product Update: 2015-16 Accord and 2015-16 CR-V DTC 1890* has been posted to the Service Information System today in support of these campaigns. They include software update, parts, warranty and repair procedure information related to this product update.

**Parts Information**

Parts to conduct repairs are available for normal ordering. American Honda expects very few vehicles will require transmission replacement. As per the Service Operations Manual, DPSM authorization is required for transmission replacements. Replacement parts for SB16-053 should be ordered at the time of need, after DTC P1890 has been identified.

**Tools Information**

In support of the vehicle software update, software is available per the information in bulletin 16-053. Please follow instructions provided in installing software:

- HDS Software Version: 1.001.004 or later
- J2534 Software Information:
  - PC Application Version 1.0.0.3 or later
  - Database update 15-APR-2016 or later

As always, please make sure to check iN VIN Inquiry to determine if a particular vehicle is eligible for these or any other campaigns.

Click [here](#) for a copy of 16-053.

Click [here](#) for a copy of 16-057.